



Prepared for: /

Date of service: 10/04/25

Provider: Leon Tsigros (mechanic SAFE TO TOW)

M: 0421 221 937 / info@safetotow.com.au

Caravan Wheel Alignment Report




Travel Safely, Tow with Confidence.



Caravan Wheel Alignment

Customer Details		
Customer name	Email	Registration
Make	Vehicle model	Vehicle year
		2024

TOE IN/OUT

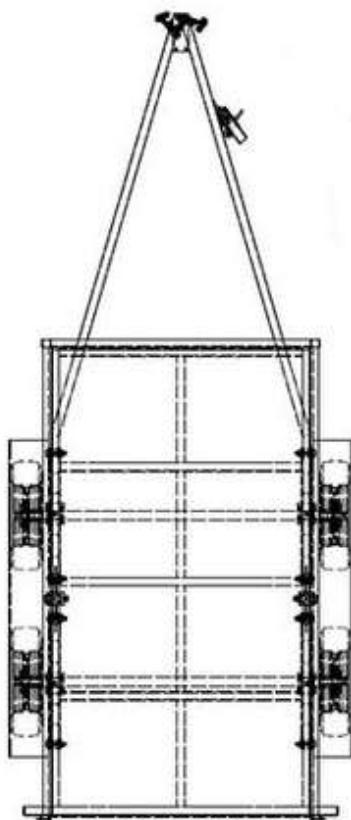

Before	After
-7mm	-0.5mm

Before	After
-1mm	0mm


Before	After
-2mm	0mm

Before	After
0mm	0mm



Caravan Wheel Alignment

CAMBER

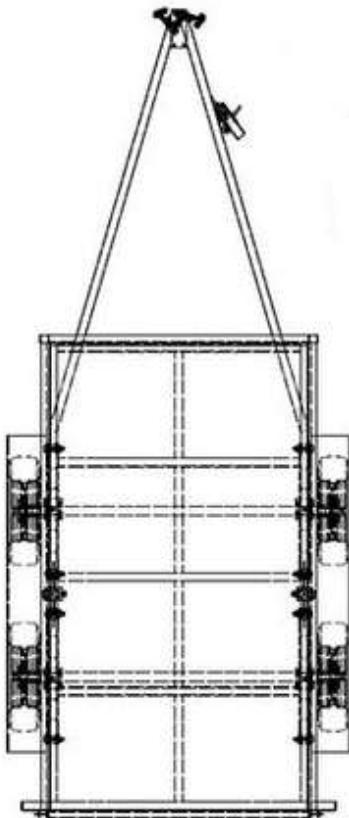

Before	After
-1.70°	-0.10°

Before	After
-0.35°	0°

Before	After
-1.05°	0.10°

Before	After
-0.40°	-0.10°

Conclusion:

The customer presented with significant sway issues on their new (MAKE/MODEL) caravan. A comprehensive scope of service was undertaken, beginning with a detailed car and caravan weigh and compliance check, followed by a wheel alignment. The weight distribution analysis revealed an underweight tow ball and excessive weight at the rear of the caravan. To rectify this imbalance, the spare wheel was relocated to the front right-hand side storage compartment. This adjustment brought the weight distribution within safe limits — please refer to the attached weigh report for all relevant figures. Following the weight correction, a wheel alignment was conducted, with adjustments made in accordance with Cruisemaster alignment specifications — refer to the before-and-after report for full details.

The customer completed a test drive post-service and confirmed that the sway issue has been resolved. The caravan now handles safely and as expected.